



2010 FACILITIES ASSESSMENT SPRING HILL ELEMENTARY




| Project Data | |
|--------------------------------|-------------------|
| Location Code: | 239 |
| Address: | 3796 Frayser Blvd |
| Year Built: | 1056 |
| Grade Configuration: | K-5 |
| Student Capacity: | 680/760 |
| Ideal Capacity: | 654 |
| ADA Student Enrollment: | |
| Size: | 9.01 acres |
| Portables: | 4 |
| Building & Addition | 69,154 s. f. |

2010 FACILITIES ASSESSMENT SPRING HILL ELEMENTARY


| | |
|--|--|
| <p>Description:</p> <p>Existing floor contains asbestos and is in poor condition.</p> |  |
| <p>Timeline:</p> <p>TBD</p> | <p>Cost:</p> <p>\$58,000</p> |


| | |
|--|---|
| <p>Description:</p> <p>Restrooms are in very poor condition, need painting, caulking and repairing.</p> |  |
| <p>Timeline:</p> <p>TBD</p> | <p>Cost:</p> <p>\$13,000</p> |


| | |
|---|--|
| <p>Description:</p> <p>Signage needed on some restrooms.</p> |  |
| <p>Timeline:</p> <p>TBD</p> | <p>Cost:</p> <p>\$Minimal</p> |

2010 FACILITIES ASSESSMENT

SPRING HILL ELEMENTARY

| | |
|---|--|
| <p>Playground/Surfaces Equipment Status:</p> <p>Fully equipped Has antiquated rubber tuff surface</p> <p>Playground Equipment / Surface Condition:</p> <p>New equipment, good condition Good surface No fence enclosure</p> |  |
|---|--|

| | |
|--|---|
| <p>Description:</p> <p>Built up modified roof: 12 years-fair</p> <p>Built up with gravel: 12 years-fair</p> <p>Shingled roof: 12 years-fair</p> |  |
| <p>Timeline:</p> <p>TBD</p> | <p>Cost:</p> <p>\$379,290</p> |

| | |
|---|--|
| <p>Description:</p> <p>Intercom System:</p> <p>Rauland Telecenter ICS</p> <p>Installation Date: 2002</p> |  |
| <p>Timeline:</p> <p>TBD</p> | <p>Cost:</p> <p>\$50,000</p> |